

# CN3

## Odyssey Access Client Installation Instructions




Use these instructions to install the Odyssey Access Client with Federal Information Processing Standards (FIPS) enabled onto the CN3. In order to install the client, you need to:

- purchase and download the Odyssey Access Client, and obtain a license key from Juniper Networks. For information on how to purchase and download the client, go to [www.juniper.net](http://www.juniper.net).
- have Windows Mobile 6.1 v4.00.20.xxxx Premium or later installed.
- have SmartSystems Platform Bundle (SSPB) v6.00.25.0418 or later installed.


For information on how to upgrade your Windows operating system and SSPB bundle, see the *CN3 Series Mobile Computer for Windows Mobile 6.1 User's Manual* (P/N 935-018-xxx).

### To install the Odyssey Access Client with FIPS


- 1 On the CN3, tap **Start > File Explorer**. The File Explorer screen appears.

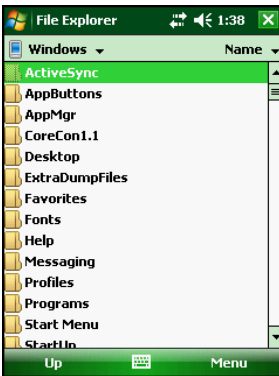

- Go to the **\Windows** directory and browse to the InstallSelect application. Double-tap the **InstallSelect** icon to open the application.

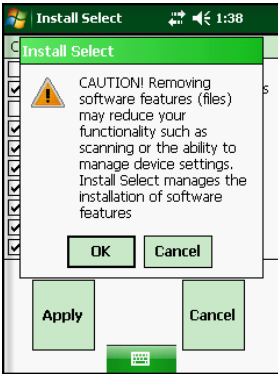


- Read the caution statement and tap **OK**.
- Uncheck the Funk Wireless Security check box and tap **Apply**. The CN3 clean boots and reinstalls the SmartSystems Platform Bundle without the Funk Wireless Security Supplicant.

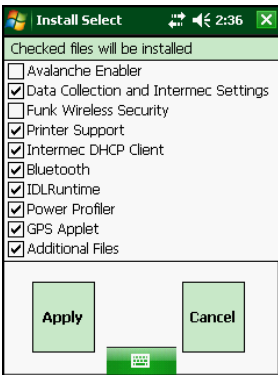

- Download the Odyssey Access Client .cab files for installation onto your PC.
- Create an ActiveSync connection between your PC and CN3. For more information, see the CN3 user's manual.
- Transfer the .cab files from your PC to the **\My Documents** folder on the CN3.
- Double-tap Odyssey Access Client installation .cab file. Odyssey Access Client installs on your computer.
- Tap **Start > Programs** and double-tap the **OAC** icon to open the Odyssey Access Client. The Odyssey Access Client screen appears.

- 10** Tap on **License Key**, enter your license key, and tap the **Add** button. The license key is added.

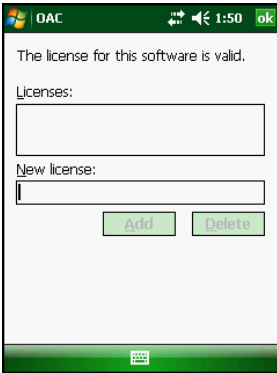

- 11** Configure your network settings, and make sure that you select the **FIPS required** checkbox to enable Federal Processing Standards (FIPS).
- 12** Restart the CN3 by holding down the **Power** button for 10 seconds and then releasing it. The CN3 restarts.

CN3G Odyssey Access Client Installation Instructions



P/N 943-238-001



Worldwide Headquarters  
6001 36th Avenue West  
Everett, Washington 98203  
U.S.A.

tel 425.348.2600

fax 425.355.9551

[www.intermec.com](http://www.intermec.com)

© 2009 Intermec Technologies  
Corporation. All rights reserved.